


SHANK Hooks

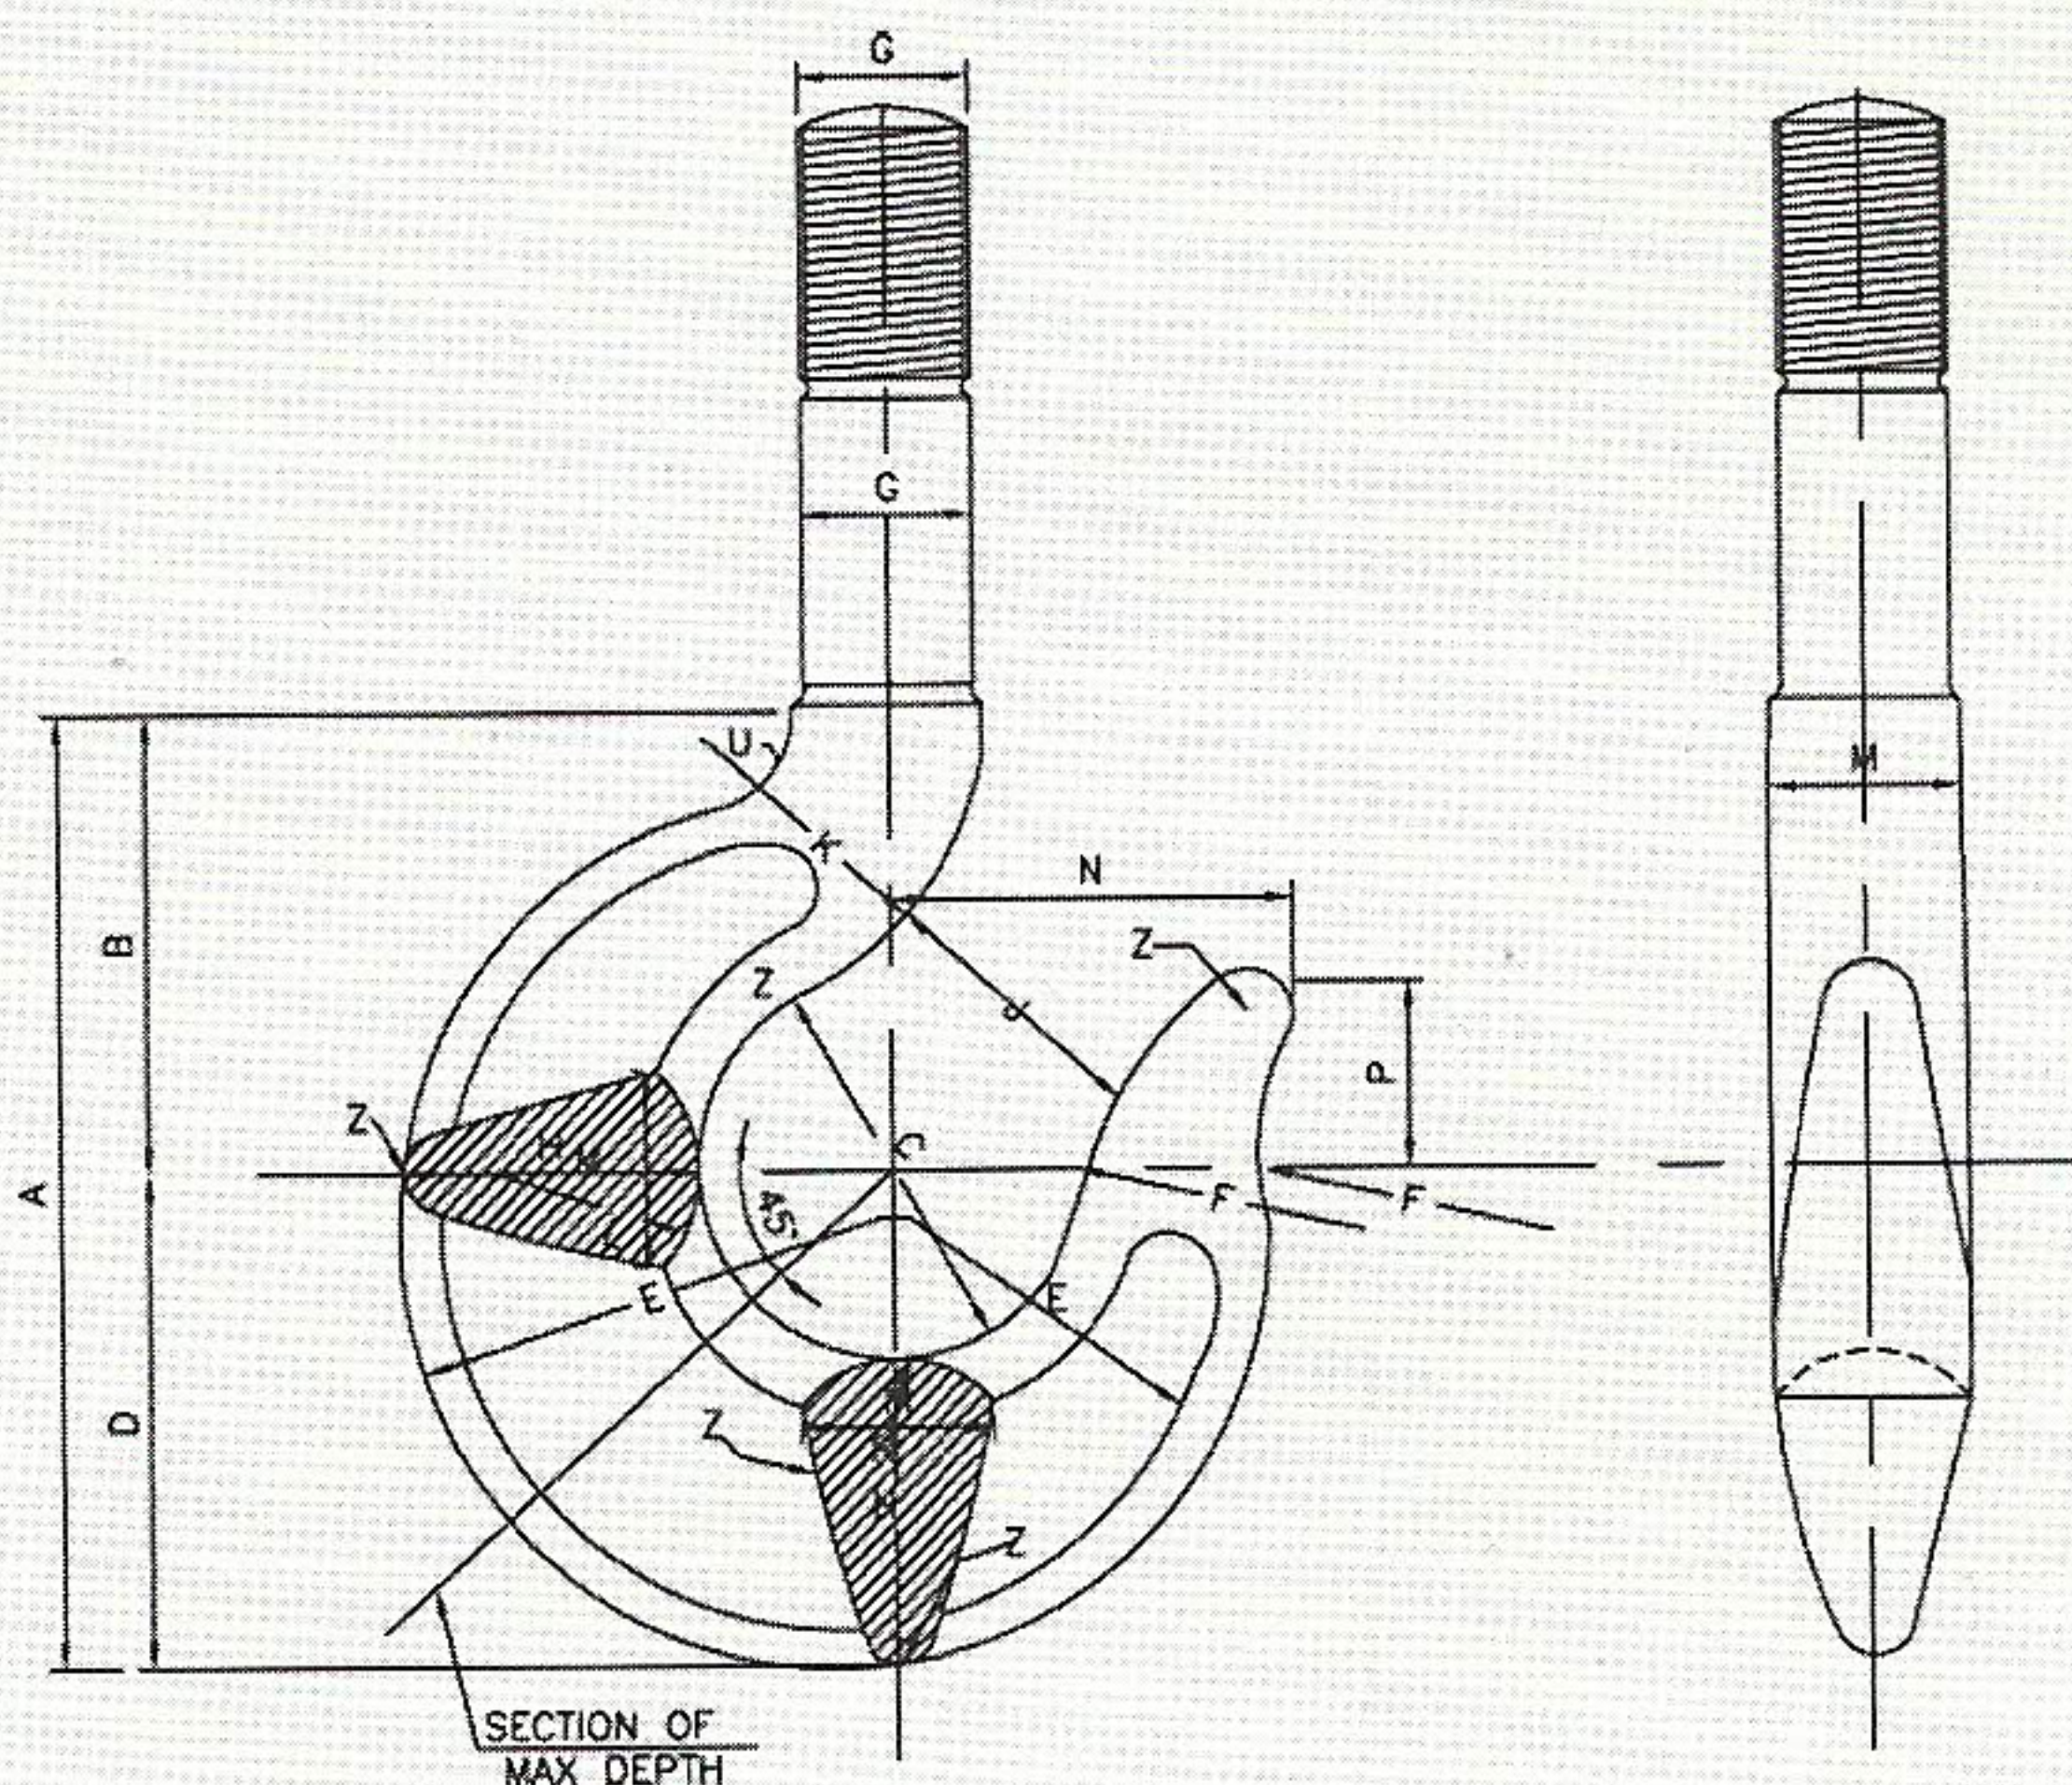

W Tons S.W.L	P Tons Proof	A (2.75 C)	B (1.31 C)	C	D (1.44 C)	E (1.25 C)	F (1.00 C)	G	Thread		H (0.93 C)	J (0.75 C)	K (0.92 C)	L (0.70 C)	M (0.60 C)	N (1.20 C)	P (0.50 C)	R (0.50 C)	U (0.30 C)	Z (0.12 C)	Ball Bearing To IS:2313-1963			
									G1 Nominal Size	Pitch											Bore	Series	Outside Dia.	Width
0.5	1	MS 74	35	27	39	34	27	15	M14		25	20	25	MS 19	16	32	14	14	8	3	15	11	28	9
		HS 63	38	23	33	29	23	12	M12		21	17	21	HS 16	14	28	12	12	7	3	12	11	26	9
1.0	2	MS 105	50	38	55	48	38	20	M20		35	28	35	MS 27	23	46	19	19	11	5	20	11	35	10
		HS 91	43	33	48	41	33	20	M18		31	25	31	HS 23	20	40	16	16	10	4	20	11	35	10
2.0	4	MS 145	69	53	76	66	53	30	M27		49	40	49	MS 37	32	64	26	26	16	6	30	12	52	16
		HS 126	60	46	66	58	46	25	M24		43	34	34	HS 32	28	55	23	23	14	6	25	12	47	15
3.2	6.4	MS 187	89	68	98	85	68	35	M33		63	51	63	MS 48	41	82	34	34	20	8	35	13	68	24
		HS 162	77	59	85	74	59	30	M30		55	44	54	HS 41	35	71	30	30	18	7	30	13	60	21
5.0	10	MS 233	111	85	122	106	85	45	M42		79	64	78	MS 60	51	102	42	42	26	10	45	13	85	28
		HS 201	96	73	105	91	73	40	M30		68	55	67	HS 51	44	88	36	36	22	9	40	13	78	26
8.0	16	MS 294	140	107	154	134	109	55	M52		100	80	98	MS 75	64	128	54	54	32	13	55	13	106	35
		HS 256	122	93	134	116	93	50	M48		86	70	86	HS 63	56	112	46	46	29	11	50	13	96	31
10.0	20	MS 327	156	119	171	149	119	60	M60		111	89	109	MS 83	71	143	60	60	36	14	60	13	110	35
		HS 286	136	104	150	130	104	55	M52		97	78	96	HS 73	62	125	52	52	31	12	55	13	105	35
12.0	25	MS 369	176	134	193	168	134	70	M68		125	100	123	MS 94	80	161	67	67	40	16	70	13	125	40
		HS 319	152	116	167	145	116	60	M60		108	87	107	HS 81	70	139	58	58	35	14	60	13	110	35
16.0	32	MS 415	198	151	217	189	151	80	M76	6	140	113	139	MS 106	91	181	76	76	45	18	80	13	140	44
		HS 360	171	131	189	164	131	70	M68	6	122	98	120	HS 92	79	157	66	66	39	16	70	13	125	40
20.0	40	MS 465	221	169	243	211	169	85	M80	6	157	127	155	MS 118	101	203	84	84	51	20	85	13	150	49
		HS 404	193	147	211	184	147	80	M72	6	137	110	135	HS 103	88	176	74	74	44	18	80	13	140	44
25.0	50	MS 520	248	189	272	236	189	100	M90	6	176	142	174	MS 132	113	227	94	94	57	23	100	13	190	63
		HS 451	215	164	236	205	164	85	M80	6	153	123	151	HS 115	98	197	82	82	49	20	85	13	150	49
32.0	60	MS 569	271	207	298	259	207	110	M100	8	193	155	191	MS 145	124	248	104	104	62	25	110	13	210	70
		HS 481	229	175	252	219	175	100	M90	6	163	131	161	HS 122	105	210	88	88	52	21	100	13	190	63
40.0	70	MS 616	293	224	323	280	224	120	M110	8	208	168	206	MS 157	134	268	112	112	67	27	120	13	210	70
		HS 533	254	194	279	242	194	110	M100	8	180	146	178	HS 136	116	233	97	97	58	23	110	13	190	63
50.0	85	MS 680	324	247	356	309	247	130	M120	8	229	187	227	MS 173	148	296	124	124	74	30	130	13	225	75
		HS 588	280	214	308	268	214	120	M110	8	199	160	197	HS 150	128	257	107	107	64	26	120	13	210	70